

USB 3.2 Cloner & Dock for M2 + **NVMe + SATA**

Quick guide

136-49





www.sandberg.world



Warranty

There is a five-year warranty on your Sandberg product. Please read the warranty terms and register your new Sandberg product at www.sandberg.world/warranty



http://helpdesk.sandberg.world



USB 3.2 Cloner & Dock fo M2 + NVMe + SATA Item no. 136-49

www.sandberg.world Sandberg A/S Breaneroedvei 133D. 3460 Birkeroed, Denmark



Quality Tested





For information on handling electronic waste, see www.sandberg.world/weee





Product preview

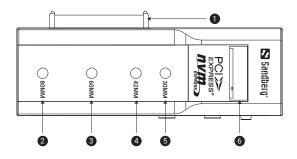


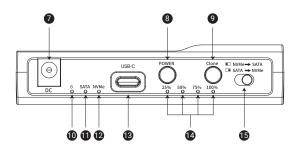


- 1, 3,5" / 2,5" SATA connector
- 2 2280 disk
- 3. 2260 disk
- 4. 2242 disk
- 5. 2230 disk
- 6. NVMe M-key connector
- 7. DC for power supply
- 8 Power button
- 9. Clone button
- 10. Power indicator
- 11 SATA disk indicator
- 12. NVMe SSD indicator
- 13. USB-C (connect to the data port of PC)
- 14. Clone progress indicator
- 15. Clone setting key




Connection



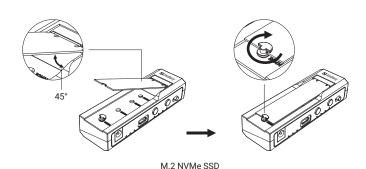




Connection

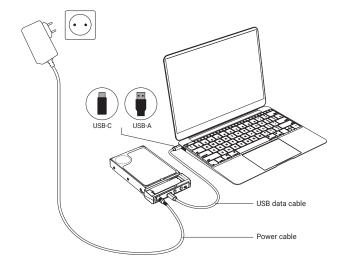



Dock function

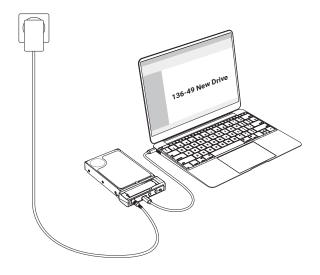

Read and write to the disks connected to the dock. **NOTE:** Brand new drives must be formatted before use.



Offline clone

1.

USB data cable You must disconnect the dock from your PC when you perform an offline clone. Connect to power NOTE: Before starting clone process, please make sure that the target disk has greater capacity than the source disk.





2.

